



# Buckingham Mfg. Co. Inc.

## Inspection Check List for Shock Absorbing Lanyards and Harnesses


The following photos and descriptions outline conditions for which a Shock Absorbing Lanyard or Harness SHOULD BE LABELED UNSAFE AND BE TAKEN OUT OF SERVICE.

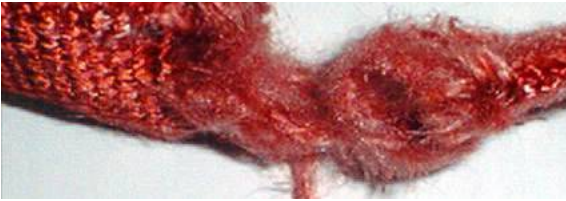


ABRADED WEBBING

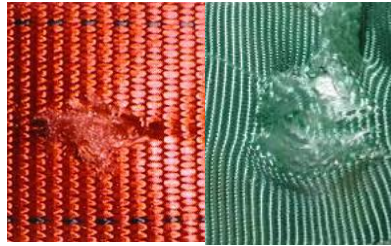

CUT IN WEBBING

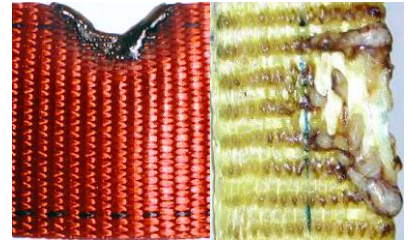

BURN IN WEBBING

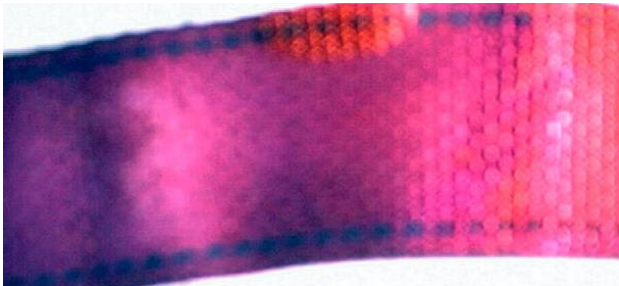


WEBBING EXPOSED TO  
CHEMICAL AGENT



HOLES IN  
WEBBING



LOOSE  
STITCHING

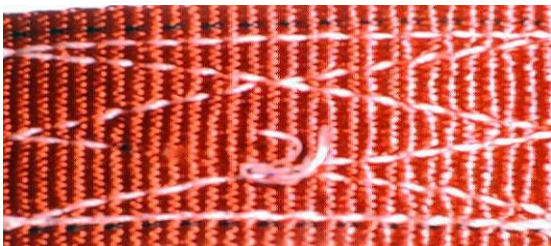

BROKEN STITCHING IN WEBBING



HEAVY FRAYING OF WEBBING



EXCESSIVE WEAR  
EXPOSING RED WEAR MARKER  
(1" YELLOW WEB)



DEPTH OF KEEPER IN BILL  
3/16" Minimum



KEEPER TENSION: Less Than 2.5 lbs  
\*Note: Locking Mechanism must be depressed for  
Keeper Tension check.



LOCKING MECH: Less Than 1.5 lbs



BENT OR DEFORMED  
GROMMETS




EXCESSIVE WEAR OF HARDWARE OR CRACK (Cracks are indicated by fine black lines)



BROKEN



BENT

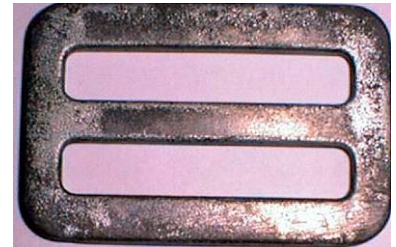

RUSTED HARDWARE



UNAUTHORIZED REPAIR / ALTERATION



HOOK AND LOOP DOES NOT ADHERE



WEBBING SUBJECT TO FALL  
(IMPACT LOADING)

**WARNING (IMPORTANT)**

THE CONDITIONS OUTLINED IN THE ABOVE PHOTOS ARE NOT ALL INCLUSIVE TO ALL CONDITIONS THAT COULD RENDER A SHOCK ABSORBING LANYARD OR HARNESS UNSAFE. IT IS THE INDIVIDUALS RESPONSIBILITY TO INSPECT HIS/HER EQUIPMENT BEFORE EACH USE. IF THERE ARE ANY QUESTIONS AS TO THE SAFETY OF HIS/HER EQUIPMENT THEY SHOULD CONTACT THEIR SAFETY COORDINATOR OR CALL THE MANUFACTURER OF THE EQUIPMENT FOR GUIDENCE.

**BUCKINGHAM MFG. COMPANY, INC**

Binghamton, New York  
(607)773-2400  
[www.buckinghammfg.com](http://www.buckinghammfg.com)